
Technical Bulletin

Boxer 4K30 Light Engine Replacement Precaution


This bulletin provides a replacement precaution for the Boxer 4K30 light engine to prevent damage from occurring to the red formatter board.

Affected products

- Boxer 4K30

Replacement precaution

When removing or replacing the light engine, ensure special care is taken around the red formatter board and the fan duct. If you do not lift light engine straight out or replace it straight in, the formatter board may contact the fan duct, which can disable the red formatter board.

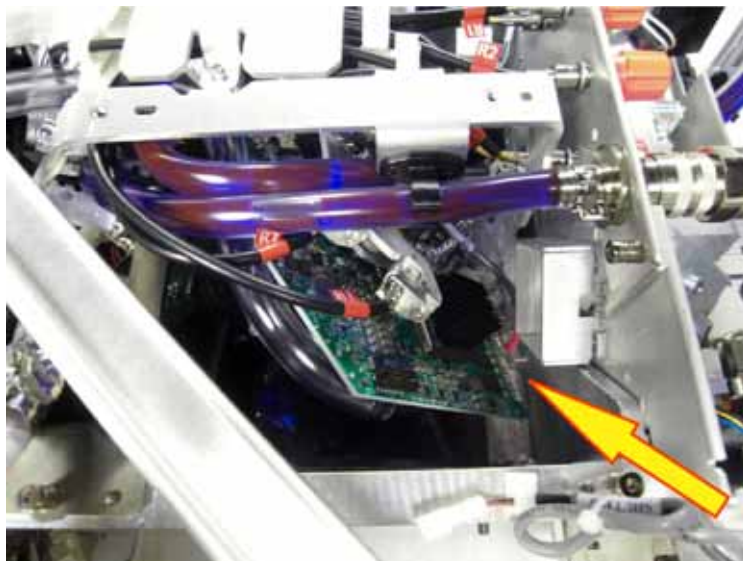

Technical support

North and South America: +1-800-221-8025 or tech-support@christiedigital.com

Europe, Middle East, and Africa: +44 (0) 1189 778111 or techsupport-emea@christiedigital.com

Asia Pacific: tech-asia@christiedigital.com